

CONSOLIDATION TEST

1. Objective: The Consolidation test is to obtain soil data which is used in predicting the rate and the amount of settlement of the structures. The two most important soil properties furnished by a consolidation test are the coefficient of compressibility (a_v), through which one can determine the magnitude of the compression and the coefficient of consolidation (c_v) which enables the determination of the weight of compression under a load increment. The data from laboratory consolidation test also gives useful information about the stress history of the soil.

2. Apparatus Required:



Consolidometers in fixed-ring or floating-ring models are required for testing soil samples with Consolidation Load Frames. Consolidometer Accessories include porous stones, calibration discs, cutting sample rings and Grade 54 filter paper, and are compatible for use in testing soil consolidation.

Fig. 1: Consolidation Test Apparatus

3. Reference: IS 2720(Part 15):1986 Methods of test for soils: Determination of Consolidation Properties (First revision). Reaffirmed- Dec 2016.

4. Procedure:

A. Preparation of Test Sample:

1. Weigh the empty consolidation ring, designated W_1
2. If the specimen is to be prepared from a tube sample, a representative sample for testing shall be extruded and cut off, care being taken to ensure that the two plane faces of the resulting soil disc are parallel to each other. The thickness of the disc of soil shall be somewhat greater than the height of the consolidation ring.

If the specimen is to be prepared from a block sample, a disc similar in size to

that specified above shall be cut from the block with two parallel faces. The diameter of the disc shall be at least 10 mm greater than the inside diameter of the consolidation ring. Care shall be taken to ensure that the soil stratum is oriented such that the laboratory test will load the soil in the same direction relative to the stratum as the applied force in the field.

3. Using the weighed consolidation ring as a template, the edges of the disc obtained in step 2 shall be trimmed carefully until the ring just slides over the soil. The last fraction of soil is pared away by the cutting edge of the ring as it is pushed down slowly and evenly over the sample with no unnatural voids against the inner face of the ring; this process is best done using a mechanical guide to prevent tilting or horizontal movement of the ring. The top and bottom surfaces shall project above and below the edges of the ring to enable final trimming. Should an occasional small inclusion interfere with the trimming operation, it shall be removed, and the cavity filled completely with material from the parings. Alternatively, if sufficient sample is available, it would be preferable to eventually extrude and discard the portion of the specimen containing the inclusion from the ring, leaving a specimen free of such disturbed zones. If inclusions are known to exist in a soil sample, a large diameter consolidation ring should be used, in order to minimize the relative effect of the disturbed zones. If excessive inclusions be encountered during trimming, the sample should be discarded. If no alternative exists, the tube sample shall be extruded directly into a consolidation ring of equal diameter.
4. The soil sample thus obtained shall be trimmed flush with the top and bottom edges of the ring. For soft to medium soils, excess soil should be removed using a wire saw, and final trimming may be done with a straight edge if necessary. For stiff soils a straight edge alone may be used for trimming. Excessive remoulding of the soil surface by the straight edge should be avoided. In the case of very soft soils, special care should be taken so that the specimen may not fall out of, or slide inside the ring during trimming.
5. A sample of soil similar to that in the ring, taken from the trimmings, shall be used for determining moisture content.

6. The thickness of the specimen (H_0) shall be measured and it shall be weighed immediately (W_2) should the nature of the soil make satisfactory thickness determination difficult, the ring height may be assumed as specimen height.

B. Loading:

1. For consolidation testing, it is generally desirable that the applied pressure at any loading stage be double than that at the preceding stage. The test may, therefore, be continued using a loading sequence which would successively apply stress of 0.1, 0.2, 0.4, 0.8, 1.6, 3.2, etc, kgf/cm² on the soil specimen.
2. For each loading increment, after application of load, readings of the dial gauge shall be taken using a time sequence such as 0, 0.25, 1, 2.25, 4, 6.25, 9, 12.25, 16, 20.25, 25, 36, 49, 64, 81, 100, 121, 144, 169, 196, 225, etc, min, up to 24 hour(s) or 0, 1/4, 1/2, 1, 2, 4, 8, 15, 30, 60 min, and 2, 4, 8, 24 hour(s). These time sequences facilitate plotting of thickness or change of thickness of specimen against square root of time or against logarithm of time. The loading Increment shall be left at least until the slope of the characteristic linear secondary compression portion of the thickness. versus log time plot is apparent, or until the end of primary consolidation is indicated on a square root of time plot. A period of 24 hours will usually be sufficient, but longer times may be required. If a period of 24 hours is seen to be sufficient, it is recommended that this commonly used load period be used for all load increments. In every case, the same load increment duration shall be used for all load increments during a consolidation test.
3. It is desirable that the final pressure be of the order of at least four times the pre-consolidation pressure, and be greater than the maximum effective vertical pressure which will occur in situ due to the overburden and the proposed construction.
4. On completion of the final loading stage, the specimen shall be unloaded by pressure decrements which decrease the load to one-fourth of the last load. Dial gauge readings may be taken as necessary during each stage of unloading. If desired, the time intervals used during the consolidation increments may be adopted; usually it is possible to proceed much more rapidly.

5. In order to minimize swell during disassembly, the last unloading stage should be to 0.05 kgf/cm^2 which should remain on the specimen for 24 hours. On completion of this decrement, the water shall be siphoned out of the cell and the consolidometer shall be rapidly dismantled after the release of the final load. The specimen, preferably within the ring, shall be wiped free of water, weighed (W_3), and thereafter placed in the oven for drying. If the ring is required for further testing, the specimen may carefully be removed from the ring in order to prevent loss of soil, and then weighed and dried.
6. Following drying, the specimen (plus ring) shall be reweighed (W_4).
7. The porous stones shall be boiled clean after the test, in order to prevent clay from drying on them and reducing their permeability.

5. Observation and Recording: The specimen data shall be recorded at the top of the data sheet shown in Appendix A. This includes apart from soil identification, etc, specific gravity of soil particles, the specimen measurements and water content determinations. The specimen preparation procedure and the type of water used shall also be specified

Appendix A

Applied Pressure (kgf/cm ²)	Final Dial Reading	Compression ΔH (cm)	Specimen Height, H_s (cm)	$e = (H/H_s) - 1$	d_e	d_a	$a_v = (d_e)/(d_a)$ (cm ² /kg)	t_{50} or t_{90} min	H_{av}	C_v (cm ² /min)
1	2	3	4	5	6	7	8	9	10	11
a										
b										
c										
d										


The data concerning dial readings with time for each pressure increment for both loading and unloading stages shall be recorded on the data sheet shown in Appendix B.

Appendix B

Date and Time	Elapsed Time (minute)	Dial Reading	Date and Time	Elapsed Time (minute)	Dial Reading	Date and Time	Elapsed Time (minute)	Dial Reading
1	2	3	4	5	6	7	8	9
a								
b								
c								
d								

The data obtained after specimen disassembly concerning the final wet weight of the specimen (W_3) and the dry weight (W_4) shall be recorded in space provided in Appendix A.

6. Calculation: Plot dial gauge readings versus square root of "t" (see Graph 1) for each load increment and draw smooth curve joining the point. Each curve should be identified by noting down the pressure acting on the specimen during the load increment and the duration of the load increment. The coefficient of consolidation, "cv" determined from the curve, shall be recorded on the curve as well.

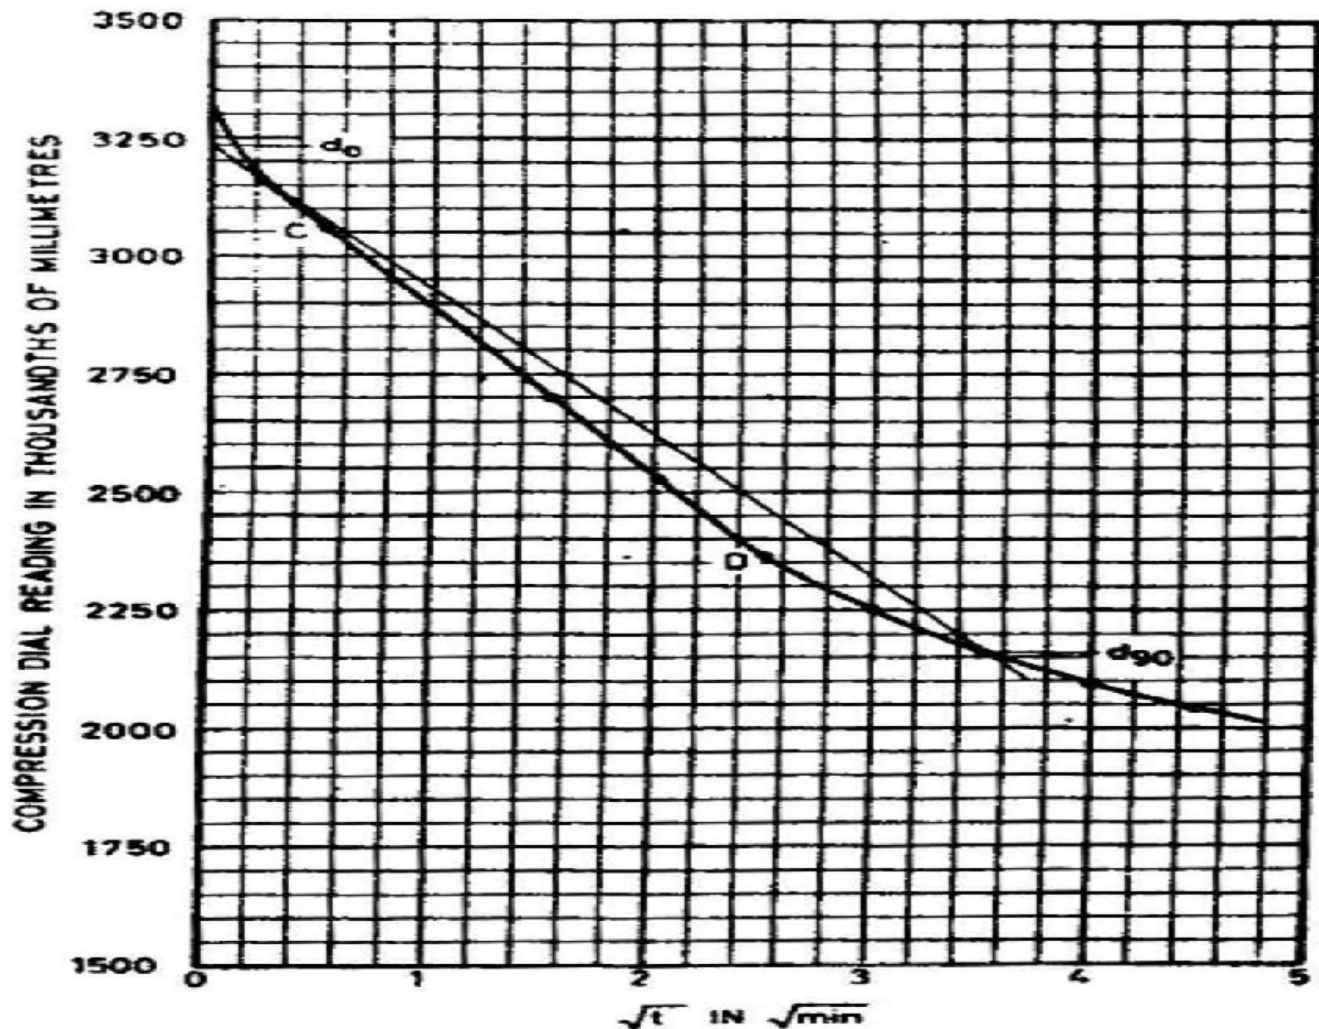

Graph 1: Plot of dial gauge readings versus square root of "t"

1. The dial reading corresponding to zero primary consolidation, that is, d_0 , is found by extrapolating the straight line portion of the curve, that is, DC back to $t = 0$.
2. Straight line is then drawn from d_0 such that the abscissae of this line are 1.15 times the abscissae of the straight line CD.

3. The point at which the drawn line intersects the experimentally obtained curve , that is, d_{90} , corresponds to 90 percent primary consolidation
4. The time required for 90 percent consolidation is read off the curve as t_{90} and recorded in col 9 of Appendix A.
5. The coefficient of consolidation, C_v for the load increment under consideration may be calculated from the formula below:

$$C_v = \{0.848 \times (H_{av}/2)^2\}/t_{90}$$

Where H_{av} is the average specimen thickness for the load increment given in col. 10 of Appendix A and C_v has units of length per unit time consistent with the units used and should be recorded in col. 11 of Appendix A.